



Service Bulletin

American Honda Motor Co., Inc.

2006 GL1800 Airbag CB Radio Squeal

Some 2006 GL1800 Airbag models equipped with the optional accessory CB radio may experience a squealing noise when transmitting.

To remedy this problem, a ferrite core harness kit is now available for installation.

AFFECTED MOTORCYCLES


2006 GL1800 VIII A (Airbag models) with optional CB Radio.

REPAIR PROCEDURE

Install a ferrite harness core kit according to the installation instructions that are packaged with the kit.


NOTE:

- The kit includes both a rider and a passenger harness; it's necessary to install both harnesses to eliminate the squealing noise.
- Passengers must route the headset cord as shown. If routed otherwise, it will be too close to the motorcycle's antenna, which can create an interference.

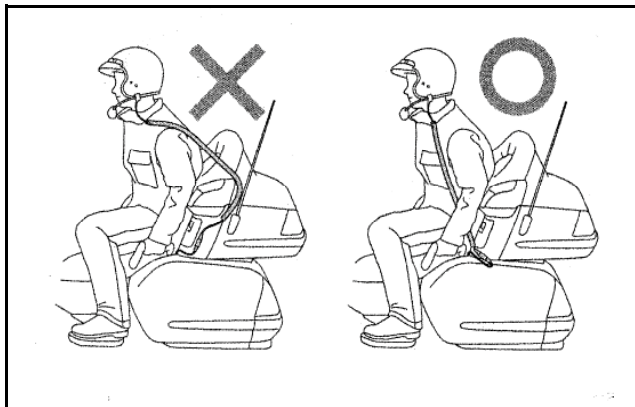

IDENTIFICATION

Subharness installation can be confirmed by removing the left-side fairing pocket, and checking to see if the harness is already installed.

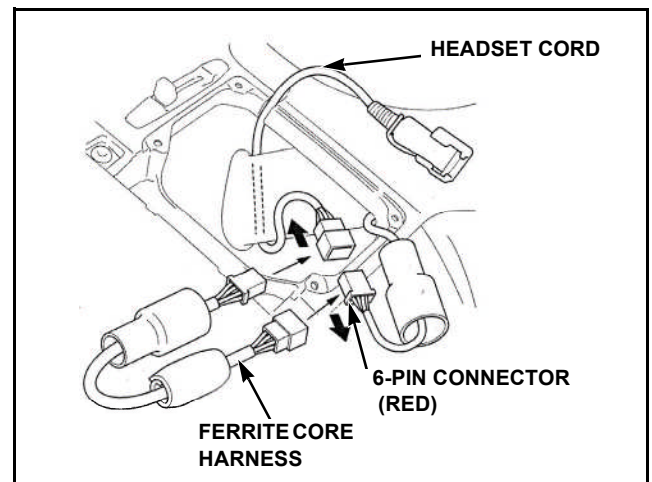

PARTS INFORMATION

Ferrite Core Harness Kit (1 required)
P/N: 08E95-MCA-100WA
H/C: 8607665

NOTE: Call TechLine at (800) 421-1900 to order parts. Due to the limited number of affected units and parts availability, ordering will be controlled until May 31, 2007.

WARRANTY INFORMATION

Normal warranty claim submission requirements apply. Submit one claim per VIN.
Template: GL19
Flat Rate Time: 0.3 hours

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your Honda. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your Honda, or that your Honda has the condition described. To determine whether this information applies, contact an authorized Honda dealer.